

Transition Plan for:
Orion Oaks County Park
Park Entrances, Roadways, and Parking
Dog Park Parking Lot

Orion Oaks County Park

Planning Area: Park Entrances, Roadways, and Parking

Recommendations:

Dog Park Parking Lot

Accessible Spaces

Issue: There are no accessible parking spaces provided or fewer than required

Solution: Add one accessible parking space next to existing accessible spaces in lieu of

creating accessible spaces in the overflow parking area

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 208.2

Priority: 1 Photo No. 1

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There are no van accessible spaces provided or fewer than required

Solution: Create one van accessible space with signage

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 208.2.4

Priority: 1 Photo No. 2

Addressed within CIPMP or MMP: Not yet scheduled

Issue: Access aisles are not marked so as to discourage parking in them

Solution: Restripe accessible parking spaces and access aisles

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 502.3.3

Priority: 1 Photo No. 2



Transition Plan for:
Orion Oaks County Park
Park Entrances, Roadways, and Parking
Dog Park Parking Lot

Issue: The accessible parking spaces and access aisles are not level

Solution: Correct cross slope of accessible parking spaces to no more than 2 percent

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 502.4

Priority: 1 Photo No. 2

Addressed within CIPMP or MMP: Not yet scheduled

Dog Dock Parking Lot

Signage

Issue: A separate parking lot for accessible parking only is not in compliance with

acccessibility requirements

Solution: Replace sign at entrance to parking lot

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 208.2

Priority: 1 Photo No. 3

Addressed within CIPMP or MMP: Not yet scheduled

Accessible Spaces

Issue: There are no accessible parking spaces provided or fewer than required

Solution: Construct at least one accessible parking space and access aisle. One space must

be van accessible.

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 208.2

Priority: 1 Photo No. 4

Transition Plan for: Orion Oaks County Park

Park Entrances, Roadways, and Parking Lake 16 Boating and Fishing Area Parking Lot

Lake 16 Boating and Fishing Area Parking Lot

Accessible Spaces

Issue: There are no accessible parking spaces provided or fewer than required

Solution: Construct at least one accessible parking space and access aisle. One space must

be van accessible.

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 208.2

Priority: 1 Photo No. 5

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There is not an International Symbol of Accessibility sign for each accessible

parking space

Solution: Add signage so that each accessible space has a sign

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 502.6 703.7.2.1

Priority: 1 Photo No. 5

Addressed within CIPMP or MMP: Not yet scheduled

Clarkston Road Parking Lot

Accessible Spaces

Issue: There are no accessible parking spaces provided or fewer than required

Solution: Construct two accessible parking spaces and access aisle. One space must be van

accessible.

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 208.2

Priority: 1 Photo No. 6



Transition Plan for:
Orion Oaks County Park
Park Entrances, Roadways, and Parking
Baldwin Road Parking Lot

Baldwin Road Parking Lot

Accessible Spaces

Issue: There are no accessible parking spaces provided or fewer than required

Solution: Construct two accessible parking spaces and access aisle. One space must be van

accessible.

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 208.2

Priority: 1 Photo No. 7

Addressed within CIPMP or MMP: Not yet scheduled

Planning Area: Park Trails and Regional Connectivity

Recommendations:

Dog Dock Area

Access Route

Issue: There are two doors or gates in a series and the distance between the doors

is less than 48 inches plus the width of the doors when swinging into the space

Solution: Lengthen area between gates on north side of parking lot

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 404.2.6

Priority: 2 Photo No. 8

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There is not an accessible route to the dock

Solution: Reconstruct the access route to the dock and at the interface of the access route

with the dock or replace with boardwalk

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 1005.1

Priority: 2 Photo No. 9, 10



Transition Plan for:
Orion Oaks County Park
Park Trails and Regional Connectivity
Lake 16 Boating and Fishing Area

Lake 16 Boating and Fishing Area

Access Route

Issue: There are two doors or gates in a series and the distance between the doors

is less than 48 inches plus the width of the doors when swinging into the space

Solution: Lengthen area between gates on north side of parking lot

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 404.2.6

Priority: 3 Photo No. 11

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There is no accessible route to the boarding pier

Solution: Create access route to boarding pier

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 1003.2.2

Priority: 3 Photo No. 12

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There is not an accessible route to the dock

Solution: Reconstruct the access route to the dock and at the interface of the access route

with the dock or replace with boardwalk

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 1005.1

Priority: 3 **Photo No.** 13, 14, 15



Transition Plan for:
Orion Oaks County Park
Park Trails and Regional Connectivity
Clarkston Road Entrance

Clarkston Road Entrance

Access Route

Issue: There is no access route or the pathway is not accessible

Solution: Create access route from accessible parking spaces to portable toilet

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 206.2.2

Priority: 3 Photo No. 16

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There is no access route or the pathway is not accessible

Solution: Create access route from accessible parking spaces to kiosk in parking lot

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 206.2.2

Priority: 3 Photo No. 17

Addressed within CIPMP or MMP: Not yet scheduled

Issue: The access route is less than 36 inches wide (and does not meet the

requirements of the exception)

Solution: Increase width between fences making up switchback gate

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 403.5.1

Priority: 3 Photo No. 18

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There are one or two picnic units, but neither, or only one, is accessible

Solution: Create access route from accessible parking spaces to picnic unit

Year of Last Assessment: 2017

Reference: ODA Reference Sections: F245.2.1

Priority: 3 Photo No. 19



Transition Plan for:
Orion Oaks County Park
Park Trails and Regional Connectivity
Clarkston Road Entrance

Issue: There is not an access route connecting accessible parking spaces to the trail

and trailhead

Solution: Create access route from accessible parking spaces to trail marker and map box

Year of Last Assessment: 2017

Reference: ODA Reference Sections: F247.3.2

Priority: 3 Photo No. 20

Addressed within CIPMP or MMP: Not yet scheduled

Baldwin Road Entrance

Access Route

Issue: There are one or two picnic units, but neither, or only one, is accessible

Solution: Create access route from accessible parking spaces to picnic unit

Year of Last Assessment: 2017

Reference: ODA Reference Sections: F245.2.1

Priority: 3 Photo No. 21

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There is not an access route connecting accessible parking spaces to the trail

and trailhead

Solution: Create access route from accessible parking spaces to kiosk

Year of Last Assessment: 2017

Reference: ODA Reference Sections: F247.3.2

Priority: 3 Photo No. 22



Transition Plan for:
Orion Oaks County Park
Park Trails and Regional Connectivity
All

All

Rustic Trails

Issue: Trail has multiple accessibility issues

Solution: As trails are upgraded, reconstruct to comply with trail guidelines to the extent

feasible

Year of Last Assessment: 2006

Reference: ODA Reference Sections: F247 1017

Priority: 3 Photo No. 22

Addressed within CIPMP or MMP: Not yet scheduled

Lake 16 Boating and Fishing Area

Trail Amenities

Issue: None of the public restrooms is accessible; there should be either one for

each sex or one unisex restroom

Solution: Replace portable toilet with accessible model and construct access route

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 213.2

Priority: 5 Photo No. 23

Addressed within CIPMP or MMP: Not yet scheduled

Issue: There are one or two picnic units, but neither, or only one, is accessible

Solution: Create an accessible picnic unit

Year of Last Assessment: 2017

Reference: ODA Reference Sections: F245.2.1

Priority: 3 **Photo No.** 24, 25



Transition Plan for:
Orion Oaks County Park
Park Trails and Regional Connectivity
Lake 16 Boating and Fishing Area

Issue: Fewer than 20 percent (minimum one) of each type of outdoor constructed

features in a common and public use area are accessible

Solution: Create clear ground space around bench

Year of Last Assessment: 2017

Reference: ODA Reference Sections: F245.3 1011

Priority: 3 Photo No. 26

Addressed within CIPMP or MMP: Not yet scheduled

Clarkston Road Entrance

Trail Amenities

Issue: There are one or two picnic units, but neither, or only one, is accessible

Solution: Create an accessible picnic unit

Year of Last Assessment: 2017

Reference: ODA Reference Sections: F245.2.1

Priority: 3 Photo No. 19

Addressed within CIPMP or MMP: Not yet scheduled

Baldwin Road Entrance

Trail Amenities

Issue: None of the public restrooms is accessible; there should be either one for

each sex or one unisex restroom

Solution: Replace portable toilet with accessible model and construct access route

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 213.2

Priority: 5 Photo No. 27



Transition Plan for:
Orion Oaks County Park
Park Trails and Regional Connectivity
Baldwin Road Entrance

Issue: There are one or two picnic units, but neither, or only one, is accessible

Solution: Create an accessible picnic unit

Year of Last Assessment: 2017

Reference: ODA **Reference Sections:** F245.2.1

Priority: 3 Photo No. 21

Addressed within CIPMP or MMP: Not yet scheduled

Planning Area: Dog Park

Recommendations:

Dog Dock

Surface

Issue: The cross slope of the fishing pier exceeds 2 percent

Solution: Adjust dock slope

Year of Last Assessment: 2006

Reference: 2010 ADASAD Reference Sections: 1005.1 403.3

Priority: 2 Photo No. 28

Addressed within CIPMP or MMP: Not yet scheduled

Planning Area: Lake 16 Boating and Fishing Area

Recommendations:

Dock

Ramp

Issue: The cross slope of the transition plate exceeds 2 percent

Solution: Adjust gangway ramp **Year of Last Assessment:** 2017

Reference: 2010 ADASAD Reference Sections: 1005.1 403.3

Priority: 3 Photo No. 29



Transition Plan for:
Orion Oaks County Park
Lake 16 Boating and Fishing Area
Dock

Surface

Issue: There is an abrupt change in the level of the dock greater than 1/4 inch

Solution: Remove trip hazards or replace benches

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 1005.1 403.4 30

Priority: 3 Photo No. 30

Addressed within CIPMP or MMP: Not yet scheduled

Railing

Issue: None or less than 25 percent of the railings, guards, or handrails are 34

inches or lower at the fishing area

Solution: Lower at least 25 percent of the guardrail to a maximum of 34 inches

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 1005.2.1

Priority: 3 Photo No. 31

Addressed within CIPMP or MMP: Not yet scheduled

Boarding Pier

Transition Plate

Issue: There is no accessible route to the boarding pier

Solution: Repair or replace transition plate

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 1003.2.2

Priority: 3 Photo No. 32

Addressed within CIPMP or MMP: Not yet scheduled

Issue: The cross slope of the boarding pier exceeds 2 percent

Solution: Rebuild pier

Year of Last Assessment: 2006

Reference: 2010 ADASAD Reference Sections: 1003.2 403.3

Priority: 3 Photo No. 33



Transition Plan for:
Orion Oaks County Park
Lake 16 Boating and Fishing Area
Boarding Pier

Issue: There are openings on the surface of the boarding pier wider than one-half

inch

Solution: Rebuild pier

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 1003.2 403.2 30

Priority: 3 Photo No. 34

Addressed within CIPMP or MMP: Not yet scheduled

Pier Openings

Issue: There is not at least one continuous clear opening 60 inches wide for at least

10 feet each of linear pier edge and/or edge protection at the clear opening is

higher than 4 inches or wider than 2 inches

Solution: Rebuild pier

Year of Last Assessment: 2017

Reference: 2010 ADASAD Reference Sections: 1003.3.2

Priority: 3 Photo No. 33